

Date: Friday, 9/21/2007 12:53:22 PM
 User: Kim Johnston

Process Sheet

44

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKIDTUBE ASSEMBLY
 Job Number : 34764
 Estimate Number : 10022
 P.O. Number : *N/A*
 This Issue : 9/21/2007 S.O. No. : *N/A*
 Prsht Rev. : NC
 First Issue : *N/A* Type : LANDING GEAR
 Previous Run : 34763
 Part Number : D205634011
 Drawing Number : N/A
 Project Number : N/A
 Drawing Revision : *N/A*
 Material : *N/A*
 Due Date : 10/30/2007 Qty: 1 Um: Each
 Written By : *[Signature]*
 Checked & Approved By : *[Signature]*
 Comment : Est Rev.P 02.08.28 Removed QC5 from Step 5 KJ

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D205-634-011 CHG005

KS 07.09.07

2.0 34764A SKID TUBE ASSEMBLY



Comment: Sub-Component SKID TUBE ASSEMBLY

D205-634-041 B *34764A**KS 07/11/01*

3.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0 K10003 D205-634-011 Saddle Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 K10003 Saddle Kit *B34810**KS 07/11/01*

5.0 QC4 INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

KS 07/11/01

6.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-011

Location: *0**07/14/01*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 01/11/10

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/21/2007 12:53:22 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKIDTUBE ASSEMBLY

Job Number: 34764

Part Number: D205634011

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Don't

Job Completion



11/11/02

34764A

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Friday, 9/21/2007 12:53:54 PM
 User: Kim Johnston

Process Sheet

44

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKID TUBE ASSEMBLY
 Job Number : 34764A
 Estimate Number : 10023
 P.O. Number : N/A Part Number : D205634041
 This Issue : 9/21/2007 S.O. No. : N/A Drawing Number : D2580 REV D
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : D
 Previous Run : 34763A Material : N/A
 Due Date : 10/30/2007 Qty: 1 Um: Each
 Written By : [Signature]
 Checked & Approved By : [Signature]
 Comment : Est Rev: N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ
 Est Rev. O 06.02.28 Added paperwork EC
 Est Rev: P 07-07-09 SS Wearplates & Gaskets JLM

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile & type labels per PPP D205-634 CHG002

SL 07.09.07
 (1)

2.0 D25001190 Ext'n -1' Beam Tube 4"



Comment: Qty.: 1.0400 Each(s)/Unit Total : 1.0400 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	29602

SL 7-9-25

3.0 D2596 205 Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	B-34791

AWM
 07/09/26

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburr ends

3-Acid etch and Alodine tube per QSI 005 4.1

SL 7-9-25
 SL 7-9-25

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/21/2007 12:53:54 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34764A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 7-9-26

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

3-Countersink holes as per Dwg D2580without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291

Sikaflex expire date: 08-27-01

Start Time: 325 Date: 07/09-26

Fin Time: 8:10 Date: 7-10-1

SL 7-9-26
DP
AWM 07/09/26
DP

7.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

EZ 7-10-1

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

AWM / DP
07-10-11

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/21/2007 12:53:54 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34764A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



*All new stuff and all good
to 02/10/11*



Comment: INSPECT WORK TO CURRENT STEP

10.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2576-3

Step

233464

BE 07/10/12

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

20

D2579

Spacers

234347

BE 07/10/12

12.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

m 105058

BE 07/10/12

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

m 105058

BE 07/10/12

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

*AWM
07-10-13*

*AWM
07-10-13*

*AWM
07-10-22*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Friday, 9/21/2007 12:53:54 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34764A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

13.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

PD 07-10-23 (1)

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 07/10/23

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

MH

07/10/29

(1X)

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M 105008

BL 07-10-29

(1)

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL 07/10/29 (1)

18.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch:

634349.

FL

19.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch:

M100188

FL

20.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch:

M104885

FL 07/10/29 (1)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action		Sign & Date	Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng				

NOTE: Date & initial all entries

Date: Friday, 9/21/2007 12:53:54 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34764A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

21.0

ALS71032130

Insert



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

Insert

Batch: m105729

FL

22.0

AN3C4A

BOLT



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

BOLT

Batch: m105810

FL

23.0

AN960C10L

washer



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

washer

Batch: m105906

FL

24.0

D356613

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: ~~m105805~~ B32744

FL

25.0

D35665

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B34354

FL

26.0

D35661

GASKET



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

GASKET

Batch: B33805

FL

27.0

D356413

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B33761

FL 07/10/29

①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/21/2007 12:53:54 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34764A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

28.0

D356411

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B34352

FL

29.0

D35649

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B34807

FL

30.0

D35645

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B34806

FL

31.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: B27168

FL

32.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: B34790

FL

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

M/05585

Sikaflex expire date: 08-07

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

FL 07/10/29 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 07/11/10

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/21/2007 12:53:54 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34764A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date: 08-07

M105585

Fwd 07/10/29

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch:

M106030

M-1

07/10/30

(1X)

34.0

QC5

INSPECT WORK TO CURRENT STEP



07/10/31



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev: PPP 34764

07/11/01

36.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

07/11/02

Job Completion



U 07/11/02

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN #	DRAWN BY RH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07-06-28 #

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241.
291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 34764A

Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

RELEASED
07-28-84

Diagram illustrating the grinding locations for the propeller cross-section:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{16}$

#0.208

DRILL PRIOR TO D2855 CAP
INSTALLATION (2 PLACES)

SEAL WITH
SIKAFLEX-241/-291

AN3-5A BOLT (1)

AN960J10L WASHER (1)

(2 PLACES)

D2855 CAP

0.40

UNF

D2579 SPACER

WEB (REF)

130 (REF)
0 PLACES

AFTER PERFORATION

1. CHAMFER
2. INSIDE
3. WELDED
4. C.B.

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C-BORE D2579 SPACER TO #0.437 X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

37.50
DISTANCE TO AFT END
OF D2596 WEB

3
7

1.750 1.750

#0.508 (TYP.)
(40 PLACES)

REFER TO DETAIL A

8.750

17.375

26.000

34.188

57.313 (REF)
7 EQUAL SPACES
8.188 PITCH

38.0

91.500

190.0
(D2500-1)

02300-041 ASSEMBLY DETAIL

WELD AS PER DETAIL B

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

0.5 1.5 1.5 D

8

1.5 1.5 1.5

P P P P P P P

REFER TO DETAIL C

03566-1 03566-5 03566-1 03566-13

03564-11 03564-5 03564-9 03564-13

AN3C4A BOLT (1)
AN960C10L WASHER (1)
(50 PLACES)


DESIGN *JJ* DRAWN BY

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.


DESIGN	<i>[Signature]</i>	DRAWN BY	<i>[Signature]</i>
CHECKED	<i>[Signature]</i>	APPROVED	<i>[Signature]</i>
DATE			
07.02.27			

DRAWING NO.	REV. D
D2580	SHEET 2 OF 3
TITLE	SCALE
205 SKIDTUBE ASSEMBLY	1:24

DETAIL E
SCALE 5:24

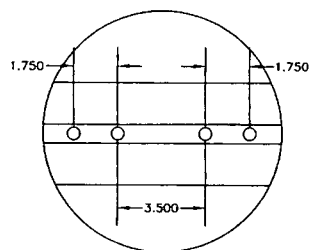


DETAIL F
SCALE 5:24

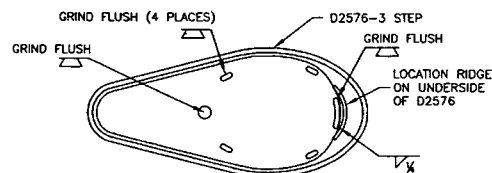


RELEASED
07 Dec 88

DETAIL G
SCALE 5:24

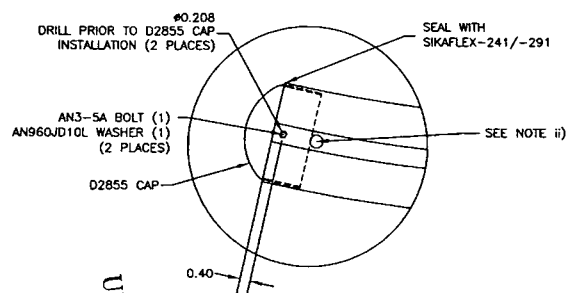


SECTION H-H
SCALE 5:24

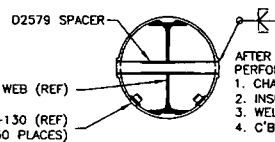


- AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
 2. INSERT D2579 SPACER (20 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP


D2580-1 DRILLING DETAIL

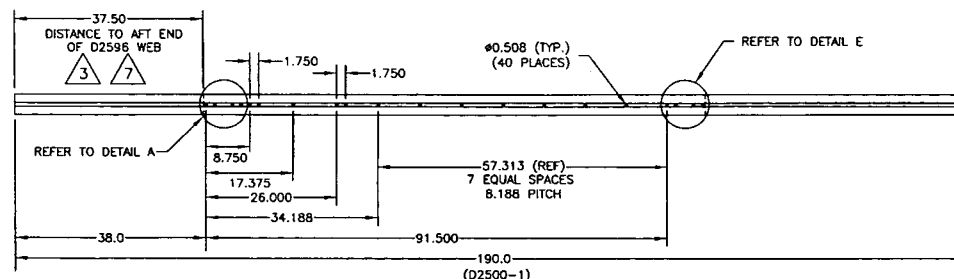

D2580-5 BENDING AND CUTTING DETAIL
(MAKE FROM D2580-1 DRILLING DETAIL)

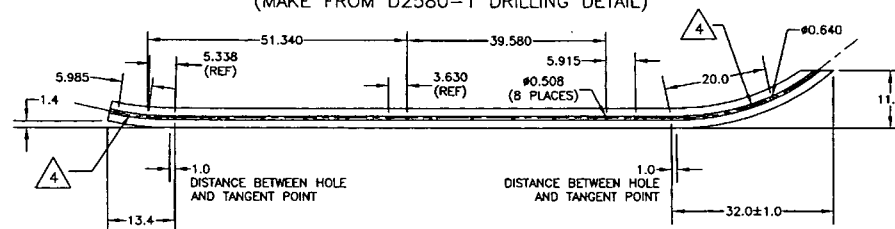

D2580-045 ASSEMBLY DETAIL

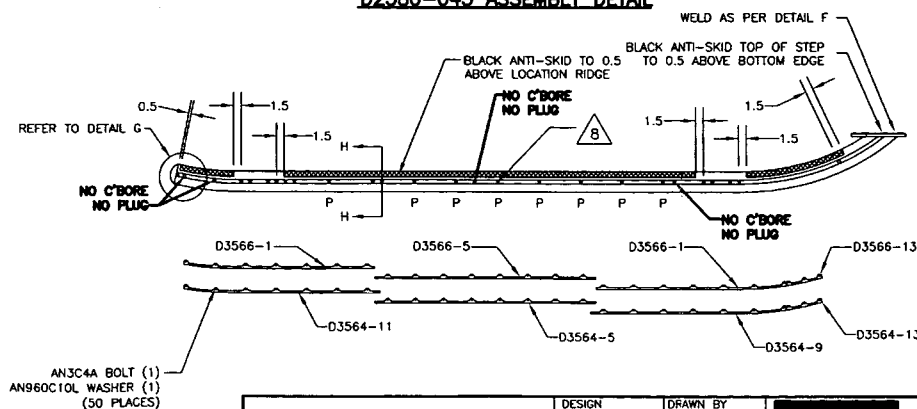

D2580-045 NOTES

- FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

COPYRIGHT © 1986 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN RH	DRAWN BY RH	DART DART AEROSPACE LTD. WARRICKSBURY, OXFORD, CANADA	REV. D
CHECKED H	APPROVED H	DRAWING NO. D2580	SHEET 3 OF 3
DATE 07.02.27	TITLE 205 SKIDTUBE ASSEMBLY	SCALE 1:24	

NO. 224

AWS D17.1.2001

QUALIFICATION TEST RECORD

Name Frank E. Elliott
Joint Welding Procedure 2G
Part number and Job number CD205 PA 08 / 003523

TEST WELDS REQUIRED

BASIC METAL Mild Steel WELDING PROCESS Gas
Penetration Complete Partial Single Weld Double Weld
Current AC DC Backing YES NO

Position Vertical Down Up

	1G	2G	3G	4G
Sheet Groove	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Tube Groove	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sheet Fillet	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Tube Fillet	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual	Pass <input checked="" type="checkbox"/>	Fail <input type="checkbox"/>
Penetration	Pass <input type="checkbox"/>	Fail <input type="checkbox"/>
Crossbolt Spacer	Pass <input type="checkbox"/>	Fail <input type="checkbox"/>

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Part of Test Coupon CD205 PA 08 Qualifier CD205 PA 08